
Technical Information

10 / 2008

HOW TO REPAIR SMALL HOLES IN LINOLEUM

1. Before you start repairing, it is inevitable to make a test on the remaining material.
2. Clean all the holes, inclusive the fringes of the holes, by scraping them carefully with a trapezoid knife. Then wipe them out with an absorbent cotton rag soaked with spirit (please do not use nitro-dilution!) and let them dry sufficiently.
3. Mill a powder from the remaining material. Only mill a 1 mm maximum depth of the floor covering's surface.
4. Let the right dose of superglue drop in and chip in the milled powder, then sufficiently fix it towards the ground (e.g. by means of a hammer). Please proceed carefully because adhesive must not pass over the fringe of the holes. Repeat this operation until all holes are closed.
5. After filling the holes, grind them carefully and within the right direction, using a 120 grain wet polishing paper and a consolidation agent (relation 1:1). If repaired parts are not even, trim them with the bare blade of a trimming guide before you start grinding.